ISSUE 3, 1984 : DISK DRIVE 2

Model: 1541




PCB Assembly #1540048 (Schematic 1540049) requires an upgrade to the reset circuit. The upgrade consists of:

1) COMPONENT CHANGES:

R25 Change To 6.8K ohm, 1/4 W, +/-5%R57 Add 220 ohm, 1/4 W, +/-5%R58 Add 2K ohm, 1/4 W, +/-5%

2) CUT circuit trace near UA1 (See diagram)

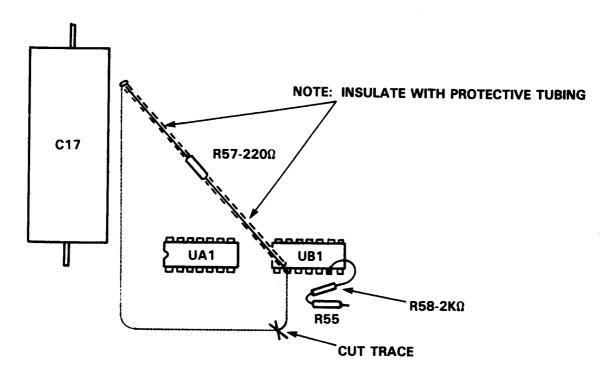

3) INSTALL JUMPER WIRES:

BETWEEN:

UA1 pin 8 and UB1 pin 5 UA1 pin 9 and CR7 Anode

UB1 pin 6 and UD3 pin 5 on BACK of board

4) CUT circuit trace between CR7 Anode and UD3 pin 5 on BACK of board.